

Ships detained in Hong Kong by PSC Section in February 2013

No	IMO Number	Ship Name	Flag	YOB	GRT	Ship Type	Class	Related ROs	Ship Company	Date of Detention	Date of Release	Nature of Deficiencies (responsible RO, if any)
1	8611752	SHENG HO	Taiwan, China	1986	11000	Bulk carrier	China Corporation Register of Shipping	China Corporation Register of Shipping	TA-HO Maritime Corp	01/02/13	06/02/13	WATER/WEATHERTIGHT CONDITIONS: ventilators, air pipes, casings/fwd deck p'side, no. 1 f.o. tank air pipe corroded seriously and holed; SAFETY OF NAVIGATION: charts/port charts BA 4122, 937 old edition, 4127 not properly corrected, NTM last edition 51/12; FIRE SAFETY: fire fighting equipment and appliances/aft 2nd deck, one fire hydrant broken
2	8896821	WAH TUNG	Honduras	1994	2758	Container	C.T.M. Inspection and Classification Company, S. de R.L. (CTMICC)	C.T.M. Inspection and Classification Company, S. de R.L. (CTMICC)	Wah Tung Shipping Asia Development Company	05/02/13	01/03/13	SAFETY OF NAVIGATION: pilot ladders and hoist/pilot transfer arrangements/pilot ladder only support by step, side ropes in seriously poor condition, nautical publications/nautical publications not available, including NTM since 2010, all sailing direction, IAMSAR vol. III; FIRE SAFETY: fire doors/openings in fire-resisting divisions/fire doors in accommodation kept open by extra rope and can not closed properly by self-close device, fire pumps and its pipes/fire pump and emergency fire pump not working; RADIO COMMUNICATIONS: MF/HF radio installation/MF/HF radio station no second source of energy; LIFE SAVING APPLIANCES: lifejackets incl. provision and disposition/most of lifejackets light battery expired; EMERGENCY SYSTEMS: emergency, lighting, batteries and switches/a large number of lights, including emergency lights wasted and detached from base, and until; POLLUTION PREVENTION - MARPOL ANNEX I: oil filtering equipment/oily water separator not working; CERTIFICATE AND DOCUMENTATION - SHIP CERTIFICATES: load lines (including exemption)/load line mark not according to load line certificate, safety management certificate (SMC/ISM)/interim SMC, ISSC exceed 6 months from issuance date (12 Jun 2012); CERTIFICATE AND DOCUMENTATION - CREW CERTIFICATES: certificates for master and officers/master, C/O, 2/O, 3/O, 2/E, 3/E, not holding valid certificates of competency, manning specified by the minimum safe manning doc/insufficient manning on board as per MSMC; ISM: documentation-ISM/no evidences of SMS established and implemented on board; POLLUTION PREVENTION - MARPOL ANNEX V: garbage management plan/no valid garbage management plan
3	8823317	PEACE	Cambodia	1988	1490	General cargo/multipurpose	Union Bureau of Shipping	Union Bureau of Shipping	Huawei Shipping Co Ltd	14/02/13	- - -	SAFETY OF NAVIGATION: Pilot ladders and hoist/pilot transfer arrangements/pilot ladder with loop on the low end; spreader broken, voyage or passage plan/voyage plan not prepared, charts/BA charts 341/937 for last and intended voy. expired, life-saving signals/rocket parachute flare & hand flare in bridge locker expired; FIRE SAFETY: fire detection and alarm system/fire detector in galley out of work during inspection, ventilation/e/r starboard side ventilator seized, fire doors/openings in fire-resisting divisions/e/r entrance fire door and stairway fire door, self closing device can't working properly, means of escape/e/r escape trunk fire door can not be closed tightly; CERTIFICATE AND DOCUMENTATION: ship certificates/continuous synopsis record/original CSR document from No. 1 to No. 8 not available o/b during inspection; WATER/WEATHERTIGHT CONDITIONS: railing, gangway, walkway and means for safe passage/some hand rail on main deck damaged and broken; RADIO COMMUNICATIONS: operation of GMDSS equipment/key officer unfamiliar with GMDSS equipment operation; LIFE SAVING APPLIANCES: rescue boats/rescue boat engine fail to start; POLLUTION PREVENTION - MARPOL ANNEX IV: sewage discharge connection/ship sewage discharge to sea directly

4	9603855	TONG CHENG 601	Panama	2010	2981	General cargo/ multipurpose	Panama Maritime Documentation Services	Panama Maritime Documentation Services	Shantou Tongcheng Shipping Co Ltd	18/02/13	26/02/13	CERTIFICATE AND DOCUMENTATION: crew certificates/certificates for master and officers/master holds coastal voyage CoC only, ship certificates/other (certificates)/ship's trading cert. incl SMC, tonnage cert, LL, SC, SE, SR, IOPP, IAPP, ISPP, AFS no longer valid since 18 Oct 2012 as informed by PMDS, need to be revalidated, ship certificates/document of compliance (DoC/ISM)/company's DOC photocopy on board invalid as informed by issuer OMCS; EMERGENCY SYSTEMS: emergency, lighting, batteries and switches/all emergency lighting not working, emergency source of power - emergency generator/emergency generator located in e/r and out of order, emergency fire pump and its pipes/emergency fire pump failed to deliver water on deck; FIRE SAFETY: fire doors/openings in fire-resisting divisions/numerous fire doors self-closing devices defective or dismantled, fire detection and alarm system/fire detection panel out of order, fire pumps and its pipes/fire pump failed to start; WATER/WEATHERTIGHT CONDITIONS: railing, gangway, walkway and means for safe passage/main deck, numerous sections of handrail missing, freeboard marks/load line mark not according to load line cert; SAFETY OF NAVIGATION: charts/BA chart 4121 old edition, 4119, 4118, 4127, 4129, 4122 not updated. NTM n/a, nautical publications/no valid sailing direction for the voyages; RADIO COMMUNICATIONS: reserve source of energy/MF/HF inoperative when main power switched off; ALARMS : general alarm/general alarm not working; LIFE SAVING APPLIANCES: rescue boats/rescue boat engine failed to start, launching arrangements for rescue boats/rescue boat launching davit inoperative
5	8744468	SHUN TAI 89	Panama	1984	1224	General cargo/ multipurpose	Overseas Marine Certification Services	Overseas Marine Certification Services	Sun Rising Shipmanagement Co Ltd	22/02/13	08/03/13	ISPS: ship security plan/ship security plan not available onboard; SAFETY OF NAVIGATION: voyage or passage plan/voyage plan for past voyage not available, charts/all navigation charts for past voyage, small correction not up to date; RADIO COMMUNICATIONS: reserve source of energy/MF/HF radio no reserve source of energy available; LIFE SAVING APPLIANCES: distress flares/rocket parachute flares & smoke signal expired; FIRE SAFETY: fire pumps and its pipes/main deck s'side, fire main pipe leakage found close to cargo hold no. 1, oil accumulation in engine room/e/r bottom, large amount of bilge accumulated (57cm in depth)
6	9630456	TAG 12	India	2010	2272	Offshore supply	Indian Register of Shipping	Indian Register of Shipping; China Classification Society	Tag Offshore Ltd	25/02/13	26/02/13	LIFE SAVING APPLIANCES: lifebuoys incl. provision and disposition/all lifebuoys in poor condition, 6 over 8 broken; SAFETY OF NAVIGATION: nautical publications/sailing direction NP30 & all NTM for BA charts for intended voyage not available onboard; FIRE SAFETY: fire fighting equipment and appliances/fire hoses leakage found at connection point during testing, not maintained ready for use
7	8107311	RAYNA	Comoros	1982	21551	Bulk carrier	Bulgarian Register of Shipping	Bulgarian Register of Shipping	Bulcom Ltd	28/02/13	08/03/13	FIRE SAFETY: fire pumps and its pipes/fire main line on main deck holed and leaked seriously during testing, means of escape/e/r escape trunk, self-closing device of fire door dismantled; POLLUTION PREVENTION - MARPOL ANNEX I: oil and oily mixtures from machinery spaces/10 cm oil accumulated in e/r tank top; SAFETY OF NAVIGATION: charts/BA charts 937/1962 for last and intended voyage were old edition

Note: The classification societies listed are not necessarily the entities carrying out the surveys relevant to the deficiencies that warranted detention and/or for issuing the certificates.