

Ships detained in Hong Kong by PSC Section in February 2014

No	IMO Number	Ship Name	Flag	YOB	GRT	Ship Type	Class	Related ROs	Ship Company	Date of Detention	Date of Release	Nature of Deficiencies (responsible RO, if any)
1	8896821	WAH TUNG	Honduras	1993	2758	Container	C.T.M. Inspection and Classification Company	C.T.M. Inspection and Classification Company	Wah Tung Shipping Asia Development Company	13/02/14	20/02/14	FIRE SAFETY: fire detection and alarm system/fire alarm and detection system defective, fire pumps and its pipes/fire main (line) at forward starboard side holed/leaked seriously during emergency fire pump operation test; LIFE SAVING APPLIANCES: lifebuoys incl. provision and disposition/man-overboard (MOB) lifebuoy smoke signal expired since Dec 2013, rescue boats/rescue boat starting battery dead and engine could not be tested; WATER/WEATHERTIGHT CONDITIONS: doors/port/starboard watertight door lower frame and accommodation bulkhead at main deck holed
2	8747874	SHUN HENG	Panama	1995	1720	Container	Overseas Marine Certification Services	Overseas Marine Certification Services	Sun Rising Shipmanagement Co Ltd	17/02/14	07/03/14	WATER/WEATHERTIGHT CONDITIONS: covers (hatchway-, portable-, tarpaulins, etc.) numerous hatch cover cleats damaged/missing, windows, sidescuttles and deadlights/one ship side window glass broken, several windows cannot be properly closed, many screw for the windows missing; STRUCTURAL CONDITIONS: decks - cracking/two cracks about 30cm each found on no. 2 hatch coaming portside; ISM/MAINTENANCE OF THE SHIP AND EQUIPMENT: many deficiencies related to maintenance were found. The shipboard safety management system related to maintenance was not properly implemented; FIRE SAFETY: fire fighting equipment and appliances/numerous fire extinguishers deteriorated/low pressure, fire doors/openings in fire-resisting divisions/numerous fire doors kept open and cannot be closed properly, fire detection and alarm system/fire alarm manual call button not work, fire-dampers/engine room ventilation fire damper seized/impossible to be closed; SAFETY OF NAVIGATION: charts/chart BA 937, 3026 4119 not updated, BA 4121, HK 0802, HK 1501 old edition; EMERGENCY SYSTEMS: emergency fire pump and its pipes/emergency fire pump not working during inspection
3	9441740	SINAR BANTEN	Panama	2007	12598	Container	Nippon Kaiji Kyokai	Nippon Kaiji Kyokai	Meiho Kaiun KK (Meiho Kaiun Co Ltd)	19/02/14	19/02/14	FIRE SAFETY: fixed fire extinguishing installation/local fire fighting/extinguishing system not working, fire detection and alarm system/cargo hold smoke detector not working, oil accumulation in engine room/purifier area oily dirty and oily rags stowed in plastic bin/engine side; PROPULSION AND AUXILIARY MACHINERY: propulsion main engine/oil mist detector for main engine not functioning

Note: The classification societies listed are not necessarily the entities carrying out the surveys relevant to the deficiencies that warranted detention and/or for issuing the certificates.