## Ships Detained in Hong Kong Due to PSC Inspection in September 2019

No.	IMO No.	Ship Name	Flag	YOB	GRT	Ship Type	Classification society	Related ROs	Company	Date of Detention	Date of Release	Nature of Deficiencies (responsible RO, if any)
1	8536146	PU SHUN	Sierra Leone	2006	4996	General cargo / multipurpose	Union Bureau of Shipping	Union Bureau of Shipping	Yongshun Shipping Management Co Ltd	07.09.2019	12.09.2019	Safety of Navigation - LATEST EDITIONS OF LOTS OF NAUTICAL CHARTS FOR LAST AND INTENDED VOYAGES WERE NOT ONBOARD. LOTS OF THEM WERE NOT UPDATED ALSO. ISM - DEFICIENCY NO. 2, 4, 9, 10, 11, 12, 15, 17, 20, 21, 23 AND 24 WERE OBJECTIVES THAT THERE WAS A FAILURE IN ENSURING THE VESSEL TO BE MAINTAINED EFFECTIVELY ACCORDING TO ISM CODE 'MAINTENANCE OF THE SHIP AND EQUIPMENT'. DEFICIENCY NO. 1, 5, 13, 16 AND 18 WERE OBJECTIVE EVIDENCES THAT THERE WAS A FAILURE IN IMPLEMENTATION OF ISM CODE 'SHIPBOARD OPERATIONS'. DEFICIENCY NO. 3, 8, 19 AND 22 WERE OBJECTIVE EVIDENCES THAT THERE WAS A FAILURE IN IMPLEMENTATION OF ISM CODE 'SHIPBOARD OPERATIONS'. DEFICIENCY NO. 3, 8, 19 AND 23 WERE OBJECTIVE EVIDENCES THAT THERE WAS A FAILURE IN IMPLEMENTATION OF ISM CODE 'EMERGENCY PREPAREDNESS'. Fire safety - CONTROL HANDLE MECHANISM OF A CLASS SELF CLOSING FIRE DOOR ON ACCOMMODATION BOAT DECK WAS REMOVED. HOLE APPEARED ON THE DOOR. FLAME AND SMOKE COULD DIRECTLY PASS THROUGH IT. Fire safety - 2 FIRE-FIGHTER'S OUTFITS (SCBA SET) WERE LEAKING VERY SERIOUSLY. REQUIREMENTS OF SOLAS COULD NOT BE FULFILED. Fire safety - FLAPS OF ENGINE FUNNEL COULD NOT BE FULLY CLOSED. GAP OF AROUND 25 MM COULD BE SEEN.
2	9157430	JUN FA	Belize	1997	9991	General cargo / multipurpose	Intermaritime Certification Services, ICS Class	Intermaritime Certification Services, ICS Class	Kind Glory Shipping Co Ltd	18.09.2019	27.09.2019	Safety of Navigation - CHIEF ENGINEER, FIRST ENGINEER DO NOT UNDERSTAND ANY ENGLISH. ALL INSTRUCTION FROM CAPTAIN, DECK DEPARTMENT IS TRANSFER TO MOTOR MAN INSTEAD OF CHIEF ENGINEER AND FIRST ENGINEER. COMMUNICATION BETWEEN DECK AND ENGINE DEPARTMENT TOTALLY FAILURE. Certificate and Documentation - TWO GENERATOR INSTALLED ON DECK DO NOT HAVE ANY CERTIFICATE. GENERATORS JUST INSTALLED SEPT. 2019, EIAPP CAN NOT BE SHOWN Pollution prevention - OILY WATER SEPARATOR ALARM TESTING WAS NOT ABLE TO SHOWN TO PSCO. NO ANY AUDIABLE SOUND ALARM Pollution prevention - MARINE GAS OIL BUNKER OIL SPILL DURING PSCO INSPECTION. ESTIMATE 200L OF MGO SPILLED FROM UPPER DECK MGO VENTILATOR AND OVER FLOW TO DECK. ISM - DEFICIENCIES NO.1,6,7,19 WERE OBJECTIVE THAT THERE WAS A FAILURE IN IMPLEMENTATION OF ISM CODE "EMERGENCY PREPAREDNESS " DEFICIENCIES NO.9,10,11,12,18,19,20,26 WERE OBJECTIVE THAT THERE WAS A FAILURE IN IMPLEMENTATION OF ISM CODE "SHIPBOARD OPERATION" CLASS AUDIT IS REQUIRED. Water/Weathertight conditions - NO.1 AND NO.2 CARGO HOLD HATCH COVER WATERTIGHT PACKING SERIOUSLY DEFORMED. GROOVE 2 CM. Fire safety - DIESEL OIL PUMP (FUEL OIL TRANSFER FROM E/R) PASS THROUGH EMERGENCY ESCAPE TRUNK BY PLASTIC HOSE TO GENERATOR ON BOARD. NO ANY CLASS APPROVAL.
3	7721225	ELITE	Palau	1978	16257	Bulk carrier	International Register of Shipping	International Register of Shipping; Russian Maritime Register of Shipping	Prayati Shipping Pvt Ltd	26.09.2019	11.10.2019	Certificate and Documentation - DOCUMENT OF COMPLIANCE EXPIRED ON 23.09.2019 Life saving appliances - PORT SIDE LIFEBOAT ENGINE COULD NOT BE STARTED Emergency Systems - EMERGENCY FIRE PUMP COULD NOT DELIVER WATER TO FORWARD HYDRANT AND 2 HYDRANTS WERE LEAKING AT AFT ACCOMMODATION Emergency Systems - EMERGENCY GENERATOR ENGINE COULD NOT BE STARTED